


PA - A(400,500)GH1 ELECTRICAL WIRING DIAGRAM

Q	R	A	MARK	REVISION RECORD	DATE	REVISED BY	CHECK BY	APPRO.
			A					
			A					
			A					
			A					

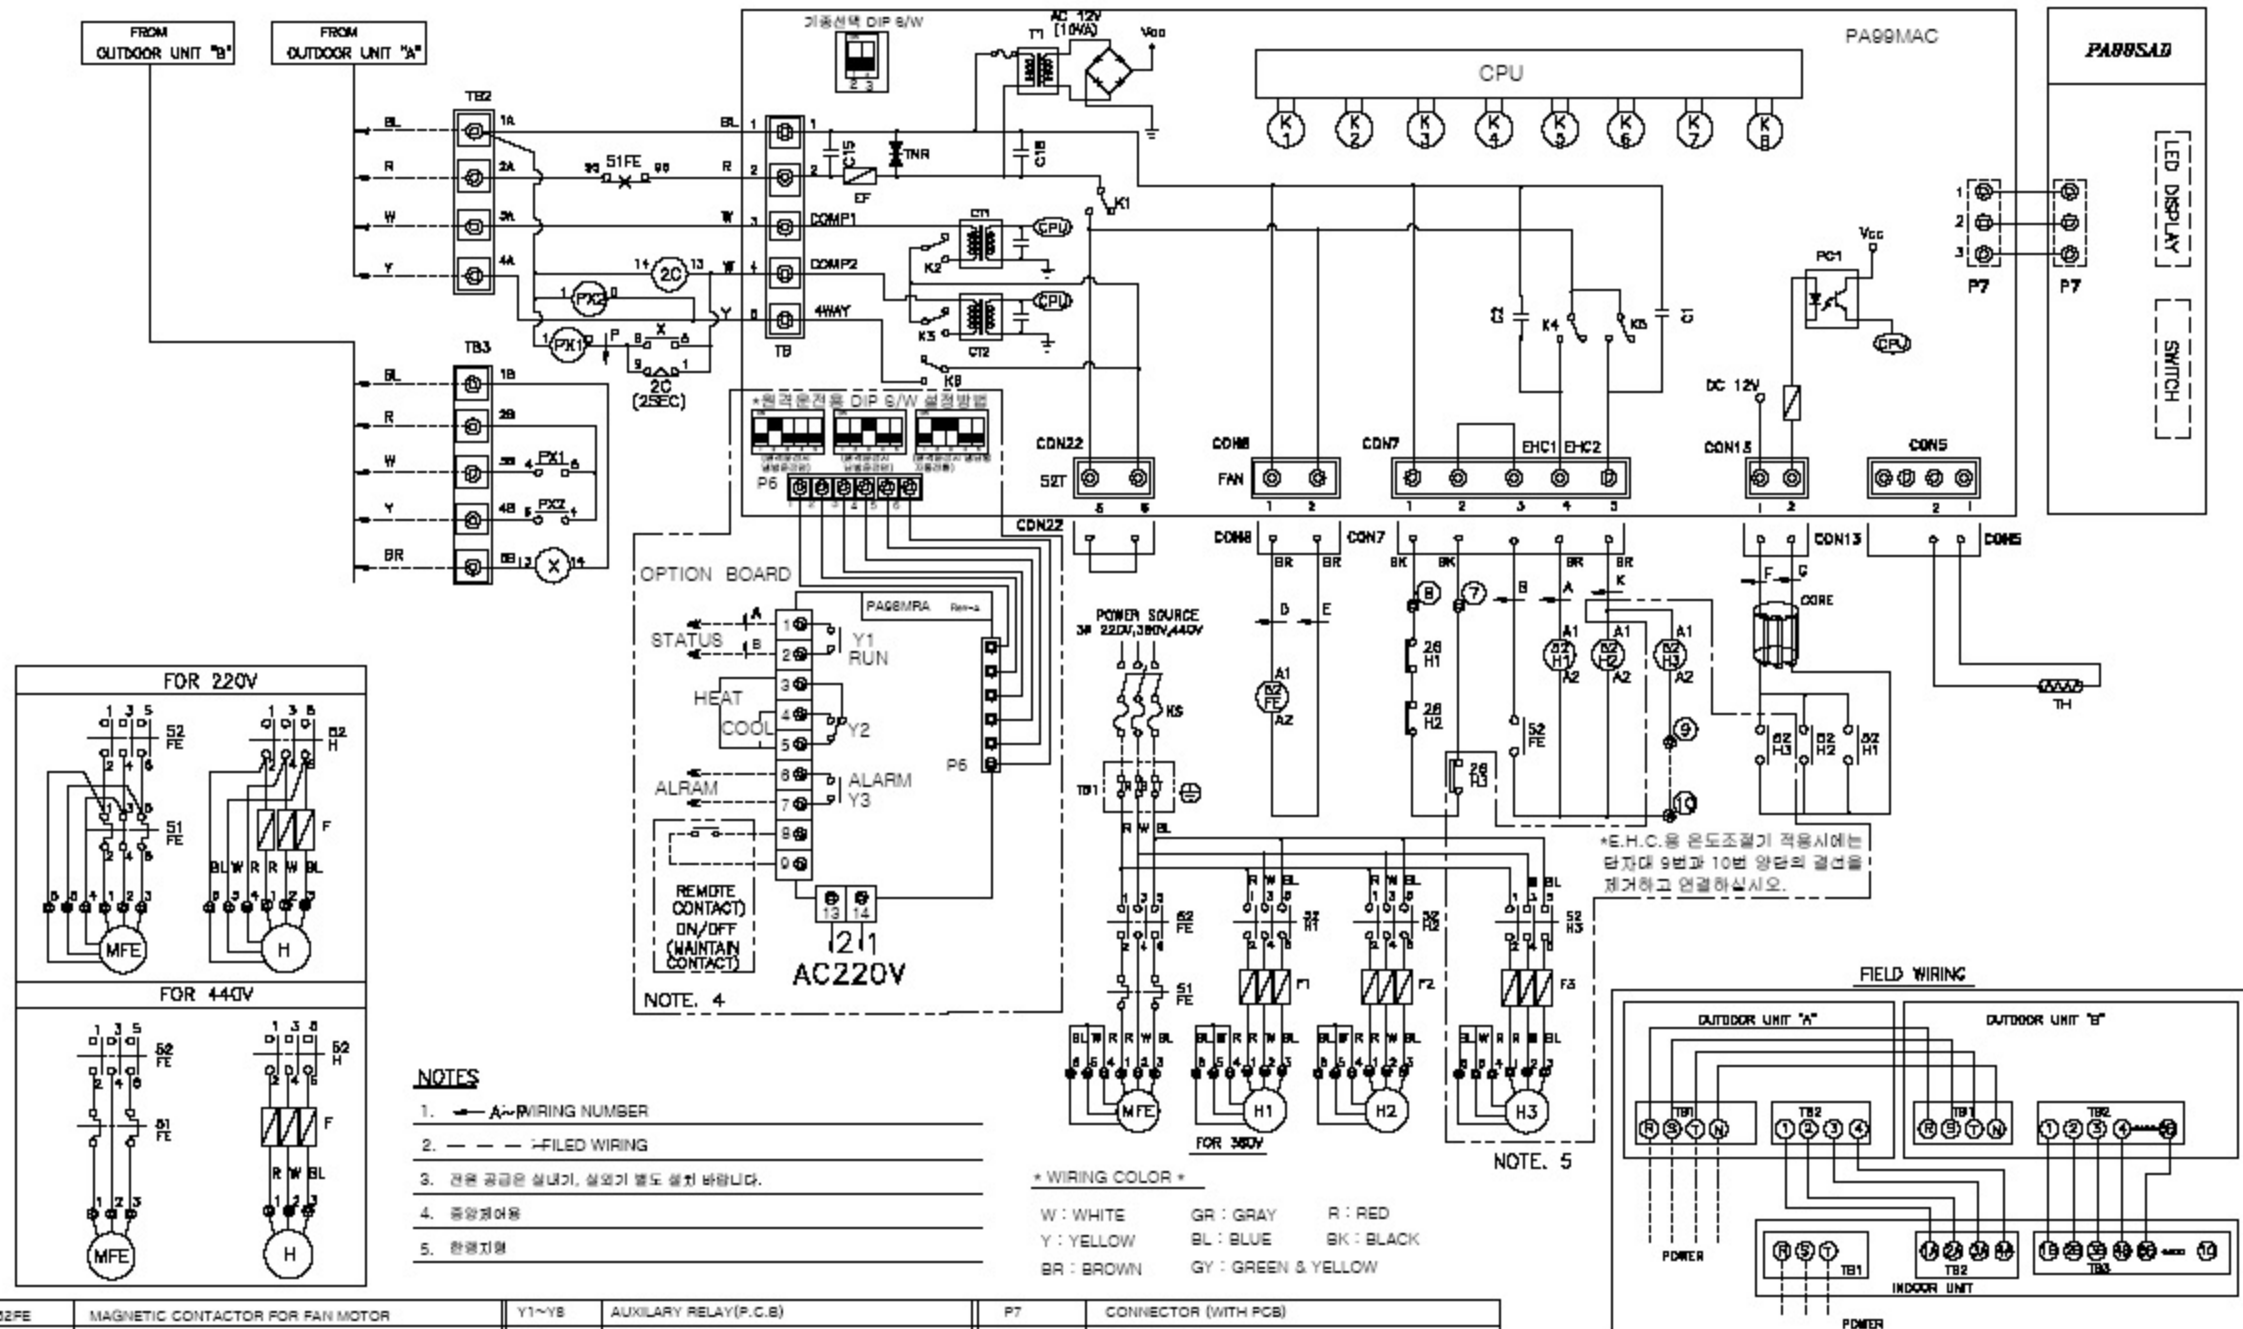

NOTES

1. A~WIRING NUMBER
2. FILED WIRING
3. 전원 공급은 실내기, 실외기 별도 설치 바랍니다.
4. 중앙제어용
5. 환경지형

52FE	MAGNETIC CONTACTOR FOR FAN MOTOR	Y1~Y8	AUXILIARY RELAY (P.C.B.)	P7	CONNECTOR (WITH PCB)
MFE	MOTOR FOR FAN	EF	ENCLOSED FUSE	TH	THERMISTOR
TB1,2	TERMINAL BLOCK	CN1	CONNECTOR	CR4	CARBON RESISTOR
TNR	ZENER DIODE	S1FE	OVER CURRENT RELAY FOR FAN MOTOR	H1~3	ELECTRICAL HEATER
PC	PHOTO COUPLER	T1	TRANSFORMER	52H1~3	MAGNETIC CONTACTOR FOR ELECTRICAL HEATER
CT1,2	CURRENT TRANS.	26H1~3	THERMOSTAT FOR OVER HEATER	23H	THERMISTOR (HEATING)
WL	PILOT LAMP FOR OPERATION(WHITE)	F1~3	POWER FUSE	N.K	NOISE KILLER
PX	POWER RELAY	X	AUXILIARY RELAY		

TECHNICAL UNITS	PRODUCT	PACKAGED	TITLE
ON-BOARD SPECIFIED	AIR	AIR CONDITIONER	ELECTRICAL
1 ~ 4	0.1	PA-A(400,500)GH1	WIRING DIAGRAM
4 ~ 18	0.2		
15 ~ 53	0.3		
53 ~ 200	0.5		
200 ~ 400	0.7		
400 ~ 1000	0.9		
THIRD ANGLE PROJECTION	SCALE	UNIT	MM
REFERENCE DIM. IN.			
DATE	REV.	PA3C1894	